



CIVIL GEOTECHNICAL SERVICES
ABN 26 474 013 724
PO Box 678 Croydon Vic 3136
Telephone: 9723 0744 Facsimile: 9723 0799

20th May 2022

Our Reference: 22276:NB1253

Winslow Constructors Pty Ltd
50 Barry Road
CAMPBELLFIELD VIC 3061

Dear Sirs/Madams,

**RE: LEVEL 1 EARTHWORKS INSPECTION AND TESTING
SMITHS LANE – STAGE 18 (CLYDE NORTH)**

Please find attached our Report No's 22276/R001 to 22276/R007 which relate to the field density testing that was conducted within the filled allotments at the above subdivision. The level 1 inspections and associated field density testing was performed in May 2022.

The inspections and testing of the earthworks was undertaken in general accordance with the Level 1 requirements of AS 3798 - Guidelines on Earthworks for Commercial and Residential Developments.

The site inspection and testing was performed by experienced geotechnicians from this office. Any areas that were deemed unsatisfactory were reworked and retested under their supervision. The testing was performed to the relevant Australian Standards and the accompanying test reports carry NATA endorsement. The attached compaction results, which were located randomly throughout the fill profile, are considered to be representative of the bulk fill materials that were placed across the reported allotments by Winslow Constructors during the aforementioned period. The approximate locations of the field density tests can be seen on the attached plan (Figure 1).

We are of the view that the bulk fill materials that have been placed across the reported allotments by Winslow Constructors during the aforementioned period can be considered as having been placed in a controlled manner to a minimum density ratio of 95% (standard compactive effort).


Please contact the undersigned if you require any additional information.

Civil Geotechnical Services

A handwritten signature in blue ink, appearing to read 'Nick Brock', is written over a light blue circular stamp.

Nick Brock

FIGURE 1

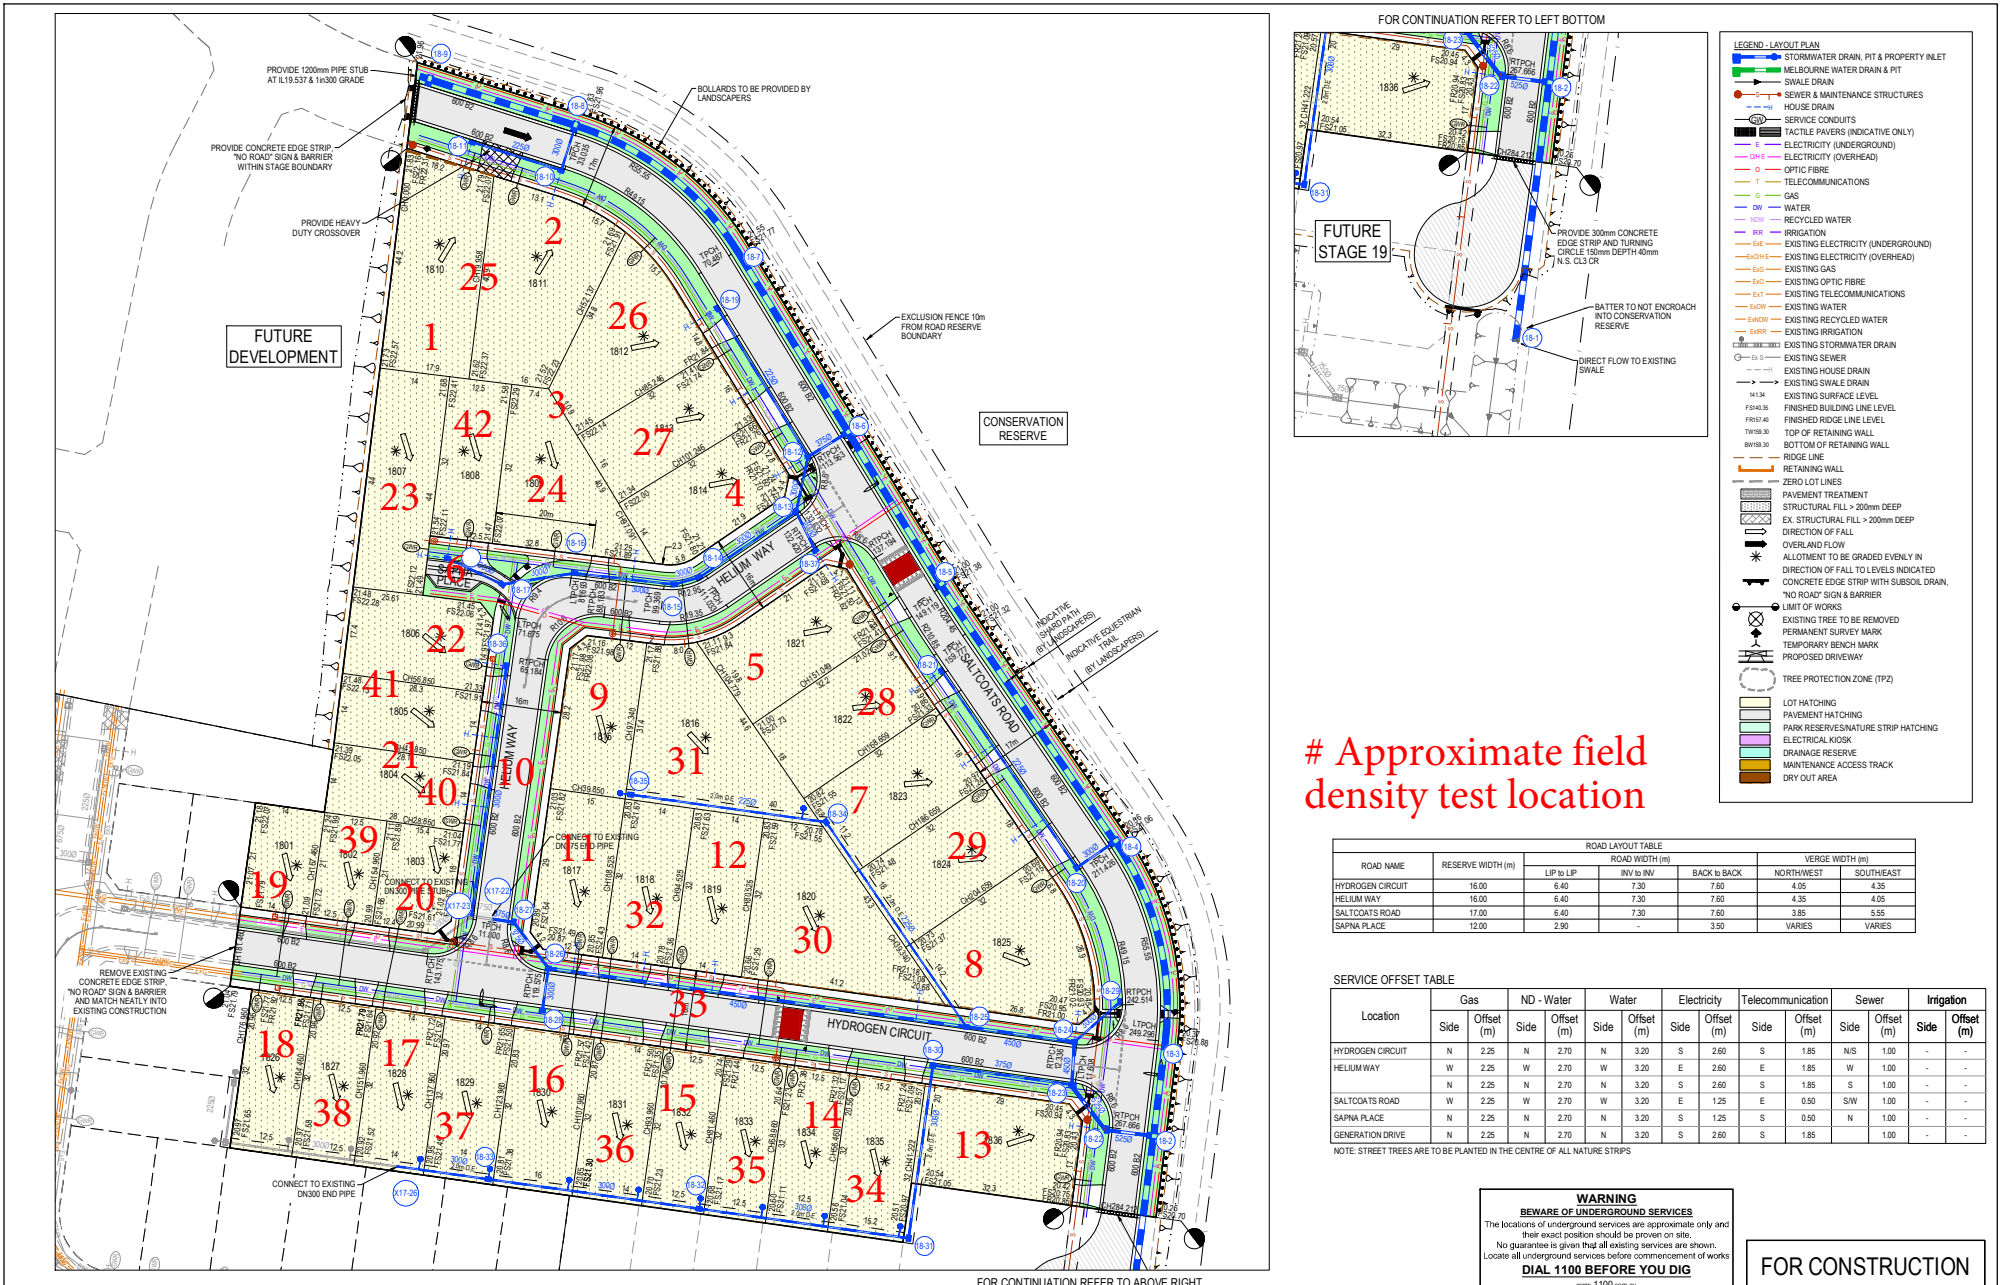

REV	DESCRIPTION	DATE	DRN	APP	REV	DESCRIPTION	DATE	DRN	APP
P5	CONSERVATION AREA AMENDED AND ACCESS ADDED	27/02/21	CD	LM	D	PIT 16-17 CHANGED TO 16-19	11/03/21	CD	LM
P4	DRAINAGE LAYOUT & PRT NUMBERS UPDATED	16/09/21	CD	LM	C	LOT 1809 CROSSOVER AMENDED	23/02/21	LM	LM
P3	COUNCIL NUMBER ADDED	16/09/21	CD	LM	B	LOT 1809 GWR CONNECTION CHANGED	23/02/21	CD	LM
P2	DRAWING TRACKED FROM BACK OF LOTS	16/09/21	CD	LM	A	ISSUED FOR CONSTRUCTION	09/02/21	LM	LM
P1	ISSUED FOR INFORMATION	24/05/21	CD	LM	P6	LOT 1811 CROSSOVER MOVED TO WESTERN SIDE	05/11/21	CD	LM

SMITHS LANE
STAGE 18
CITY OF CASEY, R5567

0 5 10 20 30 40 50

Designer: C. DAWSON
Date: 24.05.2021
Drawn: M.F. JAURIGUE
Approved: L. MURRAY
Date: 15.06.2021
PS Number: PS848720K

Beveridge Williams
1 Glenferrie Road
Melbourne VIC 3144
ph: 03 9524 8888
www.beveridgewilliams.com.au

Project Details: SMITHS LANE STAGE 18 CITY OF CASEY, R5567
Drawing Title: LAYOUT PLAN

Sheet 04 of 18
Scale: 1:500 @ A1
Project Ref: 1101438 Stage No: 18 Drawing No: 010 D

K:\Users\Gaw1101438\1101438\1101438_18\18010_LAY.dwg



COMPACTION ASSESSMENT

Job No 22276
 Report No 22276/R001
 Date Issued 20/05/2022

CIVIL GEOTECHNICAL SERVICES

6 - 8 Rose Avenue, Croydon 3136

Client	WINSLOW CONSTRUCTORS PTY LTD (CAMPBELLFIELD)	Tested by	SB
Project	SMITHS LANE - STAGE 18	Date tested	05/05/22
Location	CLYDE NORTH	Checked by	JHF

Feature	EARTHWORKS	Layer thickness	200 mm	Time: 09:00
----------------	------------	-----------------	--------	-------------

Test procedure AS 1289.2.1.1 & 5.8.1

Test No	1	2	3	4	5	6
Location	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1
Approximate depth below FSL						
Measurement depth <i>mm</i>	175	175	175	175	175	175
Field wet density <i>t/m³</i>	2.01	2.02	2.00	2.01	2.00	2.04
Field moisture content <i>%</i>	21.7	18.6	20.4	20.3	20.0	19.8

Test procedure AS 1289.5.7.1

Test No	1	2	3	4	5	6
Compactive effort	Standard					
Oversize rock retained on sieve <i>mm</i>	19.0	19.0	19.0	19.0	19.0	19.0
Percent of oversize material <i>wet</i>	0	0	0	0	0	0
Peak Converted Wet Density <i>t/m³</i>	2.07	2.06	2.08	2.07	2.05	2.07
Adjusted Peak Converted Wet Density <i>t/m³</i>	-	-	-	-	-	-
Optimum Moisture Content <i>%</i>	19.5	16.5	18.5	18.0	17.5	17.0

Moisture Variation From Optimum Moisture Content	2.0% wet	2.0% wet	2.0% wet	2.0% wet	2.5% wet	2.5% wet
--	----------	----------	----------	----------	----------	----------

density and moisture ratio results relate only to the soil to the depth of test and not to the full depth of the layer

Density Ratio (R_{HD})	%	97.5	98.0	96.5	97.5	97.5	98.5
--	----------	-------------	-------------	-------------	-------------	-------------	-------------

Material description

No 1 - 6 Clay Fill

AVRLOT HILF V1.10 MAR 13



NATA Accredited Laboratory No 9909
 Accredited for compliance with
 ISO/IEC 17025 - Testing

Approved Signatory : Justin Fry



COMPACTION ASSESSMENT

Job No 22276
 Report No 22276/R002
 Date Issued 20/05/2022

CIVIL GEOTECHNICAL SERVICES

6 - 8 Rose Avenue, Croydon 3136

Client	WINSLOW CONSTRUCTORS PTY LTD (CAMPBELLFIELD)	Tested by	SB
Project	SMITHS LANE - STAGE 18	Date tested	06/05/22
Location	CLYDE NORTH	Checked by	JHF

Feature	EARTHWORKS	Layer thickness	200 mm	Time: 10:30
---------	------------	-----------------	--------	-------------

Test procedure AS 1289.2.1.1 & 5.8.1

Test No	7	8	9	10	11	12
Location	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1
Approximate depth below FSL						
Measurement depth	mm	175	175	175	175	175
Field wet density	t/m ³	2.03	2.02	2.02	2.03	2.03
Field moisture content	%	21.7	19.2	20.6	22.7	22.9

Test procedure AS 1289.5.7.1

Test No	7	8	9	10	11	12
Compactive effort	Standard					
Oversize rock retained on sieve	mm	19.0	19.0	19.0	19.0	19.0
Percent of oversize material	wet	0	0	0	0	0
Peak Converted Wet Density	t/m ³	2.04	2.06	2.01	2.05	2.10
Adjusted Peak Converted Wet Density	t/m ³	-	-	-	-	-
Optimum Moisture Content	%	19.5	22.0	21.0	20.0	19.0

Moisture Variation From Optimum Moisture Content	2.0% wet	2.5% dry	0.0%	2.5% wet	1.5% wet	2.0% wet
--	----------	----------	------	----------	----------	----------

density and moisture ratio results relate only to the soil to the depth of test and not to the full depth of the layer

Density Ratio (R _{HD})	%	99.5	98.0	100.5	99.0	97.0	97.5
-----------------------------------	---	------	------	-------	------	------	------

Material description

No 7 - 12 Clay Fill

AVRLOT HILF V1.10 MAR 13



NATA Accredited Laboratory No 9909
 Accredited for compliance with
 ISO/IEC 17025 - Testing

Approved Signatory : Justin Fry



COMPACTION ASSESSMENT

Job No 22276
 Report No 22276/R003
 Date Issued 18/05/2022

CIVIL GEOTECHNICAL SERVICES

6 - 8 Rose Avenue, Croydon 3136

Client	WINSLOW CONSTRUCTORS PTY LTD (CAMPBELLFIELD)	Tested by	SB
Project	SMITHS LANE - STAGE 18	Date tested	09/05/22
Location	CLYDE NORTH	Checked by	JHF

Feature	EARTHWORKS	Layer thickness	200 mm	Time:	08:30
---------	------------	-----------------	--------	-------	-------

Test procedure AS 1289.2.1.1 & 5.8.1

Test No	13	14	15	16	17	18
Location	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1
Approximate depth below FSL						
Measurement depth	mm	175	175	175	175	175
Field wet density	t/m ³	2.04	2.02	2.03	2.02	2.02
Field moisture content	%	26.1	25.9	24.4	23.0	24.4

Test procedure AS 1289.5.7.1

Test No	13	14	15	16	17	18
Compactive effort	Standard					
Oversize rock retained on sieve	mm	19.0	19.0	19.0	19.0	19.0
Percent of oversize material	wet	0	0	0	0	0
Peak Converted Wet Density	t/m ³	2.05	2.07	2.06	2.05	2.07
Adjusted Peak Converted Wet Density	t/m ³	-	-	-	-	-
Optimum Moisture Content	%	25.0	25.0	24.5	22.0	24.0

Moisture Variation From Optimum Moisture Content	1.0% wet	1.0% wet	0.5% dry	1.0% wet	0.5% wet	1.0% wet
--	----------	----------	----------	----------	----------	----------

density and moisture ratio results relate only to the soil to the depth of test and not to the full depth of the layer

Density Ratio (R _{HD})	%	99.5	97.5	98.5	98.5	98.0	99.5
-----------------------------------	---	------	------	------	------	------	------

Material description

No 13 - 18 Clay Fill

AVRLOT HILF V1.10 MAR 13



NATA Accredited Laboratory No 9909
 Accredited for compliance with
 ISO/IEC 17025 - Testing

Approved Signatory : Justin Fry



COMPACTION ASSESSMENT

Job No 22276
 Report No 22276/R004
 Date Issued 18/05/2022

CIVIL GEOTECHNICAL SERVICES

6 - 8 Rose Avenue, Croydon 3136

Client	WINSLOW CONSTRUCTORS PTY LTD (CAMPBELLFIELD)	Tested by	SB
Project	SMITHS LANE - STAGE 18	Date tested	10/05/22
Location	CLYDE NORTH	Checked by	JHF

Feature	EARTHWORKS	Layer thickness	200 mm	Time:	08:00
---------	------------	-----------------	--------	-------	-------

Test procedure AS 1289.2.1.1 & 5.8.1

Test No	19	20	21	22	23	24
Location	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1
Approximate depth below FSL						
Measurement depth	mm	175	175	175	175	175
Field wet density	t/m ³	2.01	2.00	2.00	2.01	2.00
Field moisture content	%	17.1	19.8	23.7	24.3	26.0

Test procedure AS 1289.5.7.1

Test No	19	20	21	22	23	24
Compactive effort	Standard					
Oversize rock retained on sieve	mm	19.0	19.0	19.0	19.0	19.0
Percent of oversize material	wet	0	0	0	0	0
Peak Converted Wet Density	t/m ³	2.04	2.04	2.03	2.06	2.05
Adjusted Peak Converted Wet Density	t/m ³	-	-	-	-	-
Optimum Moisture Content	%	17.0	20.0	23.5	27.0	26.5

Moisture Variation From Optimum Moisture Content	0.0%	0.0%	0.0%	2.5% dry	0.0%	0.0%
--	------	------	------	----------	------	------

density and moisture ratio results relate only to the soil to the depth of test and not to the full depth of the layer

Density Ratio (R_{HD})	%	98.5	98.5	99.0	97.5	97.5	97.5
----------------------------	---	------	------	------	------	------	------

Material description

No 19 - 24 Clay Fill

AVRLOT HILF V1.10 MAR 13



NATA Accredited Laboratory No 9909
 Accredited for compliance with
 ISO/IEC 17025 - Testing

Approved Signatory : Justin Fry



COMPACTION ASSESSMENT

Job No 22276
 Report No 22276/R005
 Date Issued 18/05/2022

CIVIL GEOTECHNICAL SERVICES

6 - 8 Rose Avenue, Croydon 3136

Client	WINSLOW CONSTRUCTORS PTY LTD (CAMPBELLFIELD)	Tested by	SB
Project	SMITHS LANE - STAGE 18	Date tested	11/05/22
Location	CLYDE NORTH	Checked by	JHF

Feature	EARTHWORKS	Layer thickness	200 mm	Time: 12:00
----------------	------------	-----------------	--------	-------------

Test procedure AS 1289.2.1.1 & 5.8.1

Test No	25	26	27	28	29	30
Location	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1
Approximate depth below FSL						
Measurement depth <i>mm</i>	175	175	175	175	175	175
Field wet density <i>t/m³</i>	2.00	1.99	2.00	1.99	1.99	2.00
Field moisture content <i>%</i>	22.8	25.4	24.9	23.7	24.4	23.4

Test procedure AS 1289.5.7.1

Test No	25	26	27	28	29	30
Compactive effort	Standard					
Oversize rock retained on sieve <i>mm</i>	19.0	19.0	19.0	19.0	19.0	19.0
Percent of oversize material <i>wet</i>	0	0	0	0	0	0
Peak Converted Wet Density <i>t/m³</i>	2.05	2.02	2.05	2.01	2.00	2.03
Adjusted Peak Converted Wet Density <i>t/m³</i>	-	-	-	-	-	-
Optimum Moisture Content <i>%</i>	24.0	25.5	26.0	24.0	23.5	24.0

Moisture Variation From Optimum Moisture Content	1.0% dry	0.0%	1.0% dry	0.5% dry	1.0% wet	0.5% dry
--	----------	------	----------	----------	----------	----------

density and moisture ratio results relate only to the soil to the depth of test and not to the full depth of the layer

Density Ratio (R_{HD})	%	97.5	98.5	97.5	99.5	99.0	99.0
--	----------	-------------	-------------	-------------	-------------	-------------	-------------

Material description

No 25 - 30 Clay Fill

AVRLOT HILF V1.10 MAR 13



NATA Accredited Laboratory No 9909
 Accredited for compliance with
 ISO/IEC 17025 - Testing

Approved Signatory : Justin Fry



COMPACTION ASSESSMENT

Job No 22276
 Report No 22276/R006
 Date Issued 18/05/2022

CIVIL GEOTECHNICAL SERVICES

6 - 8 Rose Avenue, Croydon 3136

Client	WINSLOW CONSTRUCTORS PTY LTD (CAMPBELLFIELD)	Tested by	SB
Project	SMITHS LANE - STAGE 18	Date tested	12/05/22
Location	CLYDE NORTH	Checked by	JHF

Feature	EARTHWORKS	Layer thickness	200 mm	Time:	11:00
---------	------------	-----------------	--------	-------	-------

Test procedure AS 1289.2.1.1 & 5.8.1

Test No	31	32	33	34	35	36
Location	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1
Approximate depth below FSL						
Measurement depth	mm	175	175	175	175	175
Field wet density	t/m ³	1.99	1.98	2.00	2.11	2.09
Field moisture content	%	22.9	23.8	16.6	18.1	17.5

Test procedure AS 1289.5.7.1

Test No	31	32	33	34	35	36
Compactive effort	Standard					
Oversize rock retained on sieve	mm	19.0	19.0	19.0	19.0	19.0
Percent of oversize material	wet	0	0	0	0	0
Peak Converted Wet Density	t/m ³	2.02	2.02	2.04	2.13	2.11
Adjusted Peak Converted Wet Density	t/m ³	-	-	-	-	-
Optimum Moisture Content	%	21.0	23.0	15.0	17.0	16.5

Moisture Variation From Optimum Moisture Content	2.0% wet	0.5% wet	1.5% wet	1.0% wet	0.0%	2.5% dry
--	----------	----------	----------	----------	------	----------

density and moisture ratio results relate only to the soil to the depth of test and not to the full depth of the layer

Density Ratio (R _{HD})	%	99.0	98.0	98.5	99.0	99.0	99.0
-----------------------------------	---	------	------	------	------	------	------

Material description

No 31 - 36 Clay Fill

AVRLOT HILF V1.10 MAR 13



NATA Accredited Laboratory No 9909
 Accredited for compliance with
 ISO/IEC 17025 - Testing

Approved Signatory : Justin Fry



COMPACTION ASSESSMENT

Job No 22276
 Report No 22276/R007
 Date Issued 18/05/2022

CIVIL GEOTECHNICAL SERVICES

6 - 8 Rose Avenue, Croydon 3136

Client	WINSLOW CONSTRUCTORS PTY LTD (CAMPBELLFIELD)	Tested by	SB
Project	SMITHS LANE - STAGE 18	Date tested	13/05/22
Location	CLYDE NORTH	Checked by	JHF

Feature	EARTHWORKS	Layer thickness	200 mm	Time: 12:00
---------	------------	-----------------	--------	-------------

Test procedure AS 1289.2.1.1 & 5.8.1

Test No	37	38	39	40	41	42
Location	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1	REFER TO FIGURE 1
Approximate depth below FSL						
Measurement depth	mm	175	175	175	175	175
Field wet density	t/m ³	2.10	2.09	2.09	2.09	2.08
Field moisture content	%	16.1	15.9	15.9	15.6	15.3

Test procedure AS 1289.5.7.1

Test No	37	38	39	40	41	42
Compactive effort	Standard					
Oversize rock retained on sieve	mm	19.0	19.0	19.0	19.0	19.0
Percent of oversize material	wet	0	0	0	0	0
Peak Converted Wet Density	t/m ³	2.12	2.10	2.11	2.12	2.11
Adjusted Peak Converted Wet Density	t/m ³	-	-	-	-	-
Optimum Moisture Content	%	14.0	15.5	18.5	15.5	13.0

Moisture Variation From Optimum Moisture Content	2.0% wet	0.0%	2.5% dry	0.0%	2.0% wet	0.0%
--	----------	------	----------	------	----------	------

density and moisture ratio results relate only to the soil to the depth of test and not to the full depth of the layer

Density Ratio (R _{HD})	%	99.0	99.5	99.0	98.5	98.5	99.0
-----------------------------------	---	------	------	------	------	------	------

Material description

No 37 - 42 Clay Fill

AVRLOT HILF V1.10 MAR 13



NATA Accredited Laboratory No 9909
 Accredited for compliance with
 ISO/IEC 17025 - Testing

Approved Signatory : Justin Fry